	d General Information	A R. R. Consult September 1
Propeller Manufacti	irer Hurtzull	
Model HC-AZV	20-4A1	
lub Series # AK	160	Туре
ate of Manufacture		Blade #
		Printed to F made states
		TOTAL OF
	Make/Model	
craft Installed On:	Bucher A & B35 (N8819A) installed 1/25/2024	Serial #
	included the	D-2235
	1115+Wa 1/25/2024	
LADE INSPECTIONS,	REPAIRS AND ALIERATIONS	Library Property
Total Find Description	Allahon	
ROSTER, B		2V20-4A1
	Serial Number AK460	
	The propeller identified above has been	
	REPAIRED/OVERHAULED/INSPECTED	
	In accordance with manual 171	
	and is approved for return to service. Details on file under work order and 8130)_3 number 10607
OF THE STREET	Signature / // // 10	TANIMONA
A The William Property of	Fosters Propeller Service Inc. Repair State	ion F2DD014N
Controls	FOSTERPROPELLER CHARLES ON 14422 Ph. 91	8-733-2131
	FOSTERPROPELLER@WINDSTREAM.NET FOSTEI	RSPROPELLER.COM

K.R.T. Aviation LLC Tulsa, OK 74132 (KRVS) 918-710-0073 01/

01/25/2024 N8819A Hartzell model: HC-A2V20-4A1 SER: AK460 Tach: 233.1 PTT: unknown PSOH: 0.0

Installed Hartzell propeller, Model Number HC-A2V20-4A1 S/N: AK460 due to old hub did not pass overhaul specifications (for further information see previous logbook entry and FAA Form 8130-3 dated 01/16/2024). Propeller was torqued to specs, and safety wired. Performed annual inspection. Replaced hub adapter gasket, seals, centering cone, and centering cone gasket. Inspected propeller, spinner, hub, blades and bulkhead, reinstalled spinner. Performed AD compliance and found there to be no applicable AD'S due at this time. The following AD'S were complied with at ropeller overhaul dated 01/16/2024. AD97-18-02R1C was P/C/W by Foster's Propeller Service at overhaul, next due at AFIT: 3897.36, PSOH: 500.0; AD85-14-10R2 verified no longer applicable due to affected serial number of parts not installed. Pertinent details for work order #3023 are on file at K.R.T. Aviation. All work was performed in reference with the manufacturer's maintenance manual. I certify that this annual inspection was performed in accordance with 14 CFR 43 appendix D and using manufacturer's maintenance manual as reference and this PROPELLER was determined to be in an aijworthy condition for return to service.

Keith Thomas

AP3370165IA

K.R.T. Aviation LLC Tulsa, OK 74132 (KRVS) 918-710-0073

03/12/2025 N8819A Hartzell model: HC-A2V20-4A1 SER: AK460 Tach: 278.5 PTT: unknown PSOH: 45.4

Performed annual inspection, Removed spinner, inspected propeller, spinner, hub, blades and bulkhead, reinstalled spinner. Performed AD compliance and found there to be no applicable AD'S due at this time. Pertinent details for work order #3242 are on file at K.R.T. Aviation. All work was performed in reference with the manufacture's maintenance manual. I certify that this annual inspection was performed in accordance with 14 CFR 43 appendix D and using manufacturer's maintenance manual as reference and this PROPELLER was determined to be in an airworthy

Keith Thomas

AP3370165IA